
SBÏ				
ном то	Document #	Model name		
	HT00132E	ECO-55 / ECO-55ST		
REPLACE THE IGNITOR	Model number DP00070 / DP00071	Serial number100to	Date 2017-03-20	
WARNING HOT SURFACE. ALLOW TO C		DANGER DISCONNECT ALL SOURCE OF POWER BEFORE SERVICING THE		
BEFORE SERVICING.				
NOTE				
For part numbers, visit our website at www.drolet.ca/en/parts/				
TOOLS REQUIRED :	PARTS REQUIRED :			
1/8" 3 mm 5/16		gnitor		
PROCEDURE :				
	2			


HOW TO REPLACE THE IGNITOR

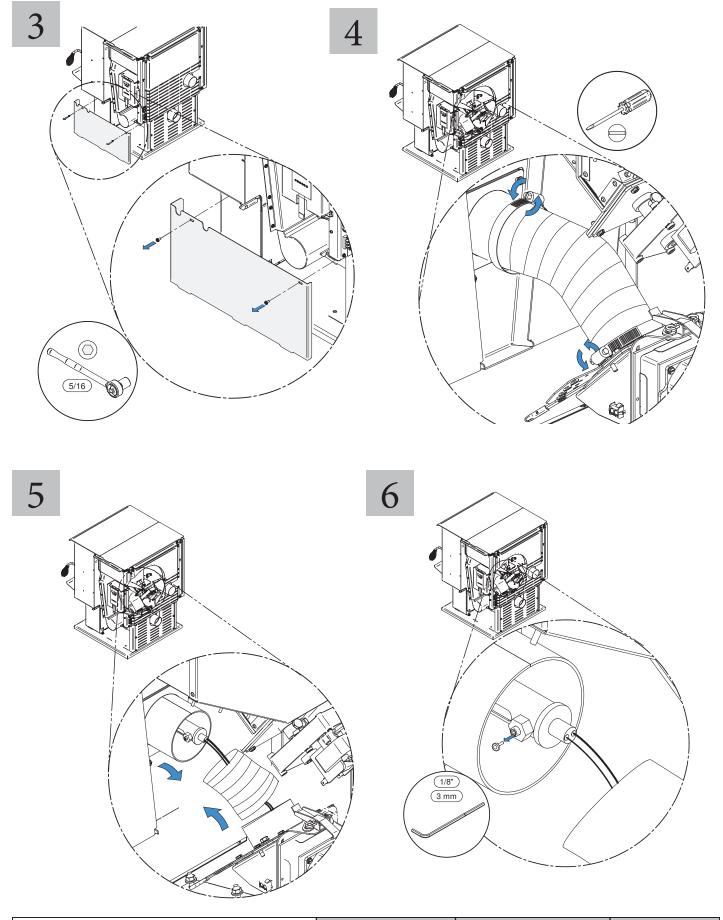



HOW TO REPLACE THE IGNITOR

HT00132E

ECO55 / ECO-55ST Page 2 of 4

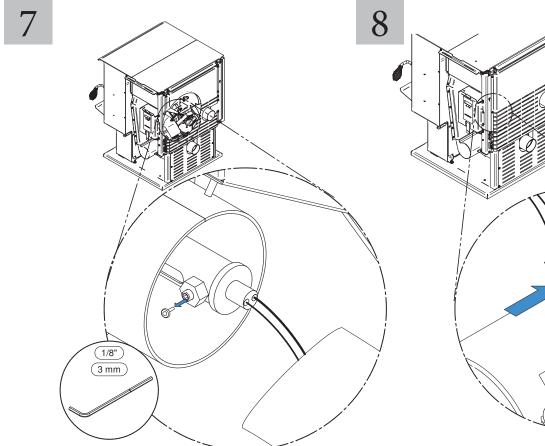

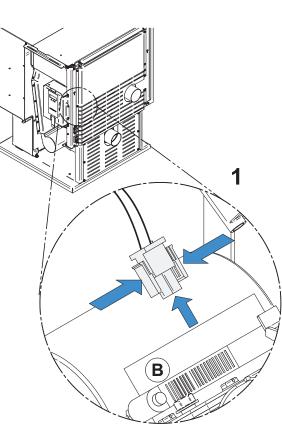

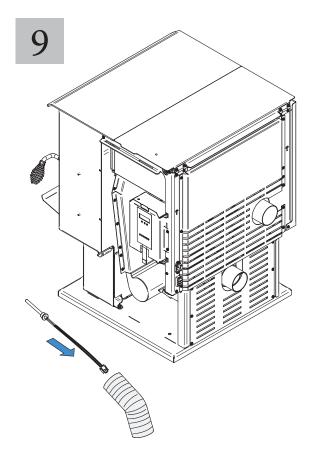

10 Follow previous steps in reverse order to reinstall.

HOW TO REPLACE THE IGNITOR

HT00132E ECO55 / ECO-55ST Page 3 of 4



This document is available for free download on the manufacturer's website. It is a copyrighted document. Re-sale is strictly prohibited. The manufacturer may update this document from time to time and cannot be responsible for problems, injuries, or damages arising out of the use of information contained in any document obtained from unauthorized sources.

Stove Builder International inc. 250, rue de Copenhague, St-Augustin-de-Desmaures (Québec) Canada G3A 2H3

> Customer service : 418-908-8002 Email : tech@sbi-international.com <u>www.drolet.ca</u>